RedMax®

TECHNICAL SERVICE BULLETIN
T09 - 02

Product Service Department

2009

To: All RedMax Distributors and Dealers
Subject: GZ3500T Carburetor

PRODUCT MODEL	SERIAL NUMBER
GZ3500T	Serial Number 8XXXXXXX

Problem:The Air Valve could become misaligned at idle preventing advancement of the throttle.

Solution: Install alignment bracket on the air valve. This bracket will keep the Air Valve linkage aligned with the Throttle Valve linkage when the Throttle lever is depressed.

Additional Note: This Bulletin DOES NOT APPLY to units with Serial Number 9XXXXXXX and up.

Important Installation Information: It is NOT necessary to remove the Carburetor bolts or Air Horn to install this bracket.

1. Remove the Air Box Cover, and Air Filter
2. Remove Screw from Carburetor
3. Lay Bracket into place as shown

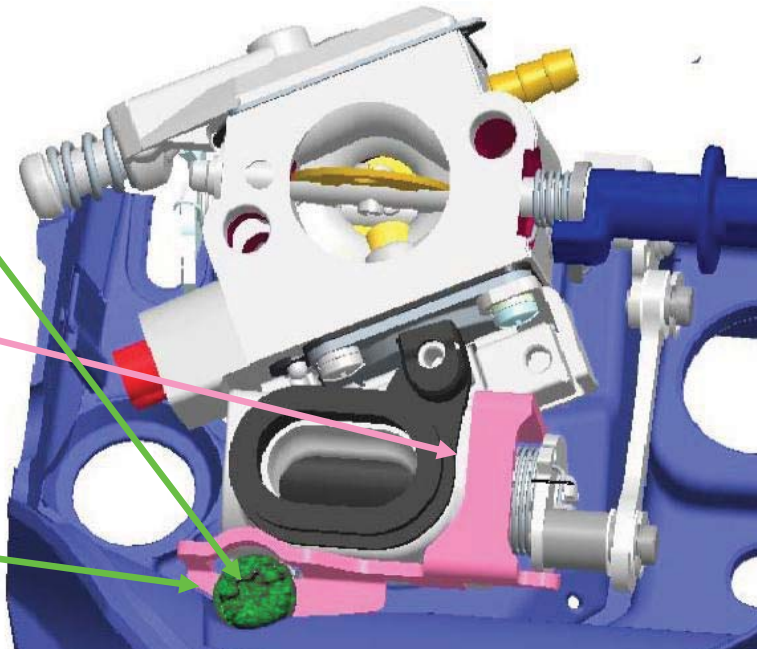

4. Reinstall screw and tighten securely
5. Reinstall the Air Box Cover, and Air Filter

MTI Canada inc.

Service en français : 1 800 463-4398
English services: 1 800 463-7205

Télécopieur / Fax : 1 800 363-7157
www.mticanada.ca